

Steven L. Beshear Governor Frankfort, Kentucky 40622 www.transportation.ky.gov/

Michael W. Hancock, P.E. Secretary

May 15, 2014

CALL NO. 320

CONTRACT ID NO. 142111

ADDENDUM # 1

Subject: Henderson County, FD05 051 2096 000-004

Letting May 30, 2014

(1) Revised - Special Note - Page 17 of 74

(2) Revised - Typical Sections - Page 25-27 of 74

Proposal revisions are available at $\frac{\text{http://transportation.ky.gov/Construction-Procurement/.}}{\text{Procurement/.}}$

If you have any questions, please contact us at 502-564-3500.

Sincerely,

Diana Castle Radcliffe

Director

Division of Construction Procurement

liana Castle biddiffe

DR:ks

Enclosures



SPECIAL NOTE FOR BASE FAILURE REPAIR

Repair locations listed on the summary are approximate only. The Engineer will determine actual repair locations and dimensions at the time of construction. Prior to overall milling and/or leveling and wedging, excavate the designated base failure areas to a depth 12 inches below the existing asphalt pavement surface level. Dispose of the excavated materials at waste sites off the Right-of-Way obtained by the Contractor at no additional cost to the Department. See Special Note for Waste and Borrow.


Backfill the excavated areas with Class 2 Asphalt Base 1.50D PG64-22. Compact the asphalt base to the compaction required in Section 403.03.10. Seal the asphalt base with leveling and wedging. Perform all base failure repairs in such a manner that removal and replacement are completed on the same day. Do this work as one of the Contractor's first operations in order to allow further compaction by traffic. Do not mill or place new asphalt surface over repaired base failure areas until a minimum of 7 calendar days have elapsed after placement of the asphalt base. After a minimum of 7 calendar days and when the Engineer determines the base failure repair areas have sufficiently stabilized, begin milling and/or resurfacing operations. Prior to milling and/or constructing the new asphalt surface, level and wedge any settlement of the repair areas.

The bidder must draw conclusions as to the conditions encountered. The Department does not give any guarantee as to the accuracy of the data and will not consider any claim for additional compensation if the materials encountered that are not in accord with the classification shown.

Accept payment at the Contract unit prices per square yard for Base Failure repair and per ton for Leveling and Wedging as full compensation for all labor, materials, equipment, and incidentals for removing pavement and disposing of the materials, furnishing and placing asphalt base, leveling and wedging, and all other items necessary to complete the work according to these notes to the satisfaction of the Engineer.


Henderson County

FD05 051 2096 000-004 TYPICAL SECTION MP 0.000-0.788

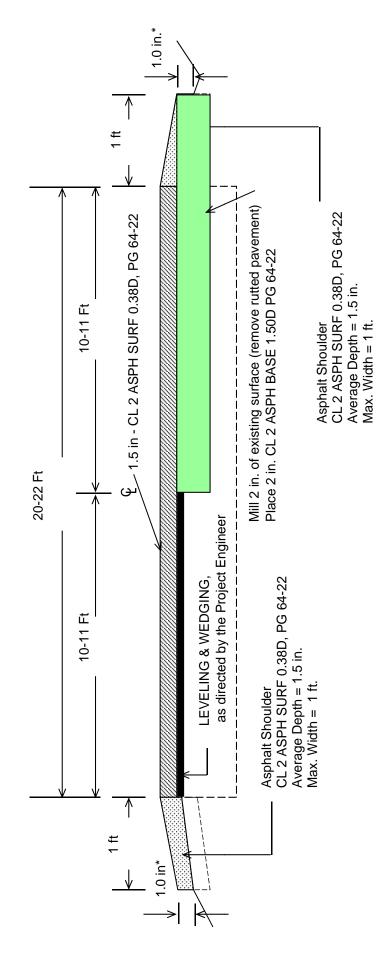


*1" Max Drop-off Where Existing Site Conditions Permit

Henderson Countv FD05 051 2096 000-004 TYPICAL SECTION MP 0.788-3.069

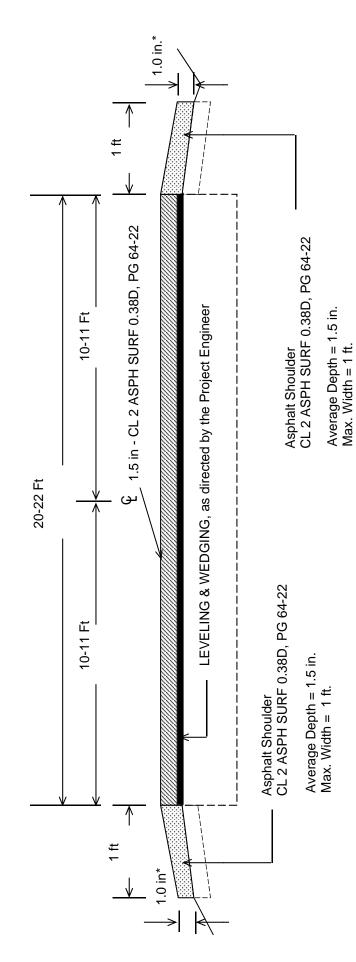

*1" Max Drop-off Where Existing Site Conditions Permit

TYPICAL SECTION

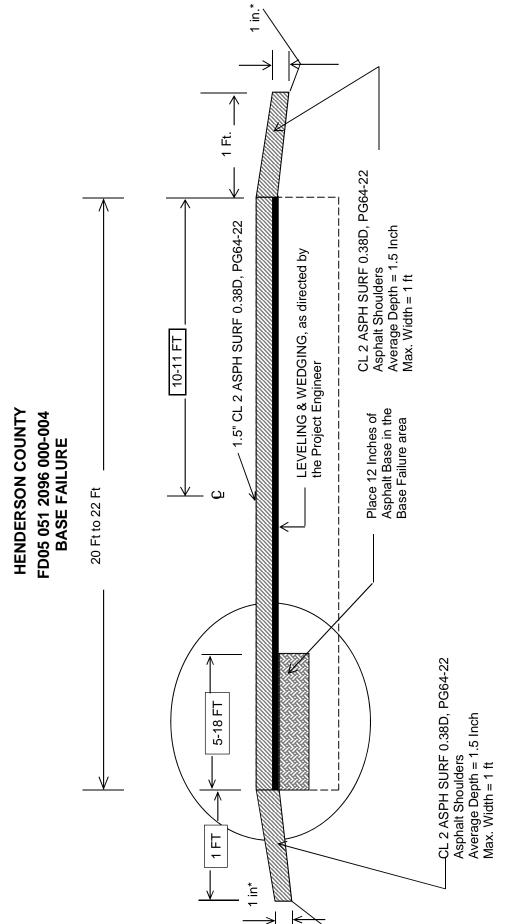

*1" Max Drop-off Where Existing Site Conditions Permit